



COMMERCIAL VEHICLE AUCTIONS LTD
THE UK'S MOST ESTABLISHED COMMERCIAL VEHICLE AUCTIONEERS

Carr Hill Industrial Estate
Doncaster
DN4 8DE

01302 732600 | cva.noreply@cva-auctions.co.uk

VEHICLE INSPECTION REPORT

FL69XEP

Vauxhall Vivaro 2900 1.5d 100PS Edition

Inspection

Serious Damage? No

Vehicle

VAT Plus VAT

V5 To Follow

Details

Reg. date	31/12/2019	Colour	WHITE	CAP Average	£6,650.00
Year	2019	VIN	VXEVBVYHRKL7006614	CAP Below	£5,200.00
Mileage	51,173 Miles Warranted	Body Style	Panel Van L1	Gearbox	MANUAL
Fuel Type	Diesel	MOT Due	11/05/2027	Gears	6
GVW	2830kg	CAP Clean	£7,725.00		

WARNING LIGHTS ON DASH TWIN SIDE LOAD DOOR, E/MIRRORS, AD-BLUE

Tyres

NSF

NSR

OSF

OSR



Spare

Features


- Bluetooth connection
- Auxiliary input socket
- Drivers airbag
- Cruise control
- Digital radio
- Passenger airbag
- Park assist camera
- Air conditioning
- Central locking
- Rear parking sensor
- Front electric windows
- Cloth seat trim

Photos



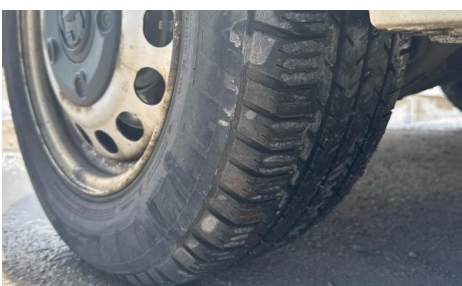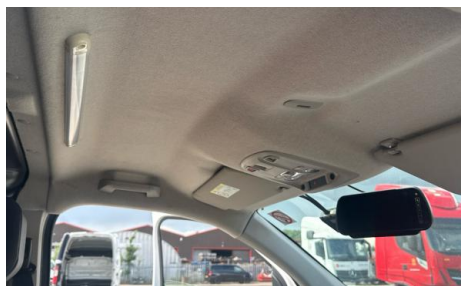


Condition Check

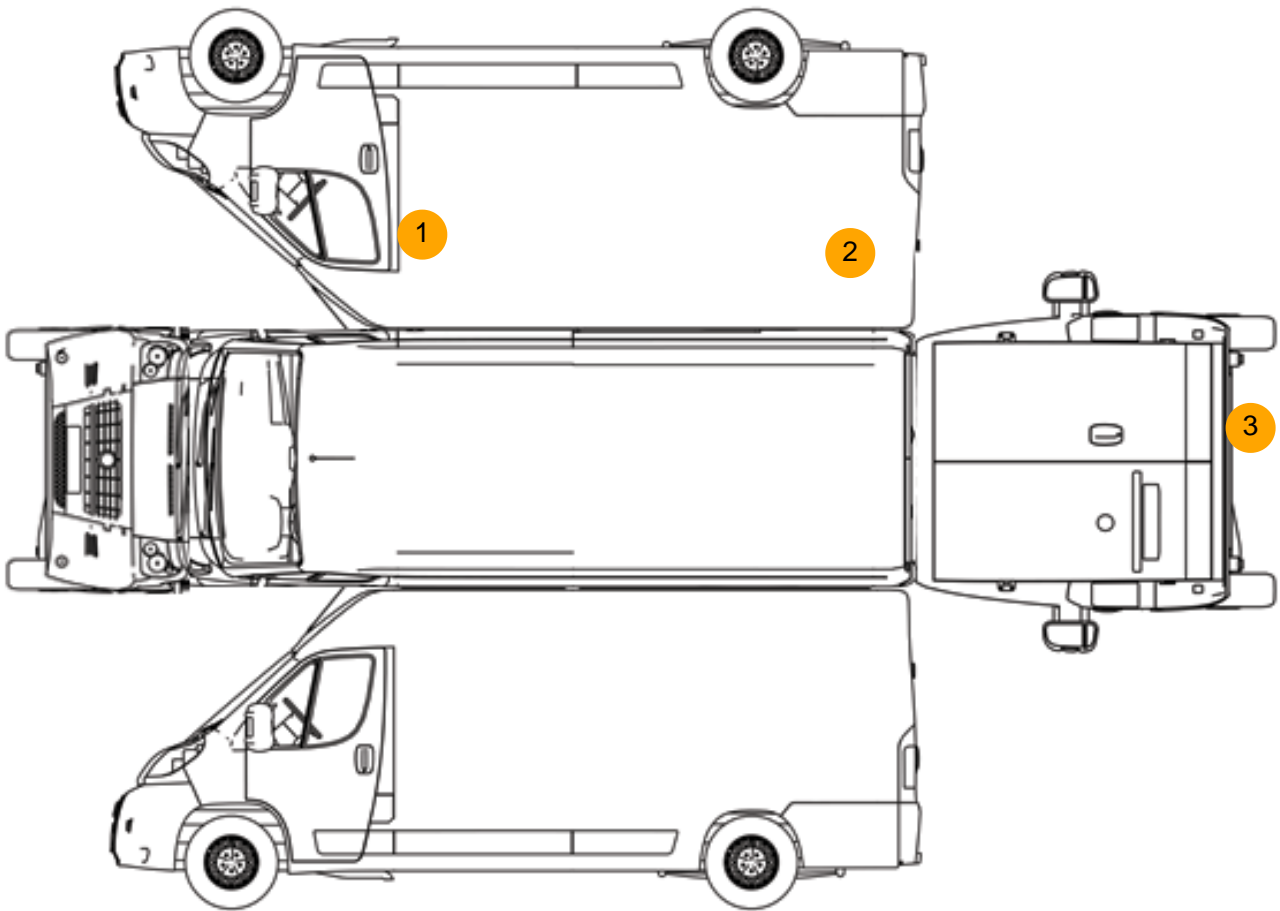

Damage Photos



1: Door osf
Chipped
Edge Chip

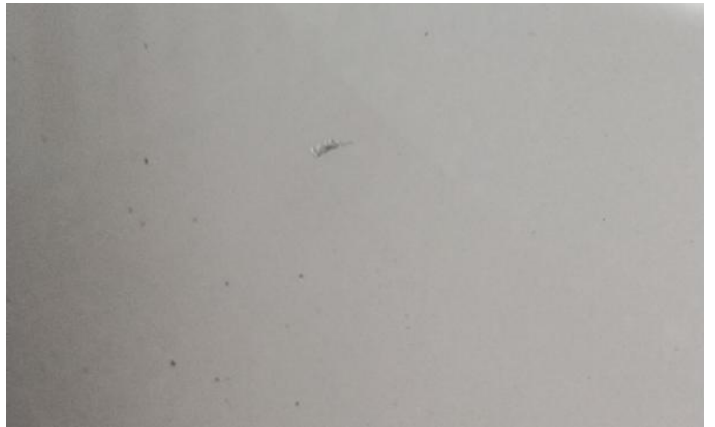

2: Panel Rear
Scratched
UpTo 25mm Thru Paint



3: Bumper Rear Moulding
Scuffed (Unpainted)
Over 100mm

4: Dash Warning Lights
Displayed
No Action



5: Carpets Front
Scuffed
Over 25mm

Interior

Carpet Condition	Average	Upholstery Condition	Average
Seat Condition	Average	Odour	No
Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK
EML light illuminated	Fault	Oil warning light illuminated	OK
Airbag light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK	Service indicator light illuminated	OK

Windows

OK

Radio

OK

Steering

OK